



Instrument Expert Original factory packaging www.keruiyigi.cn

DATA SHEET



LuminOx O₂ Sensors

Luminescence-based Optical Series



- Luminescence-based optical technology, NOT electrochemical
- Contains no hazardous materials; RoHS & REACH compliant
- Connects directly to a microcontroller without any additional circuitry
- Factory calibrated
- High accuracy
- Maintenance free^a



Housing



Supply Voltage



Operating Temp



Output Digital



Response Time



📆 BENEFITS

- Compact, diffusion-type housing with sealed base
- Low power, long life due to non-depleting sensing principle
- Low cost

OUTPUT VALUES^b

0-25% O₂ Oxygen range

0-300mbar ppO₂ Oxygen pressure range T90 < 30s (typical) Response time

Accuracy

ppO₂ < 2% FS Temperature Indication only Pressure ±5mbar

 O_2 Determined by ppO2 &

pressure accuracy

Resolution

ppO₂ 0.1mbar Temperature 0.1°C Pressure 1mbar O_2 0.01% Lifetime > 2 years

Other sensor options available on request, email:

technical@sstsensing.com

TECHNICAL SPECIFICATIONS

4.5-5.5V_{DC} Supply voltage (Vs)

Supply current (Is) <7.5mA (streaming one

sample per second),

<20mA Peak

3.3V TTL level USART **Output Type**

Temperature

Operating: -30°C to +60°C -30°C to +60°C Storage:

0-99% Rh (non-condensing) Humidity

Barometric pressure range 500-1200mbar

> **Need help?** Ask the expert Tel: + 44 (0)1236 459 020 and ask for "Technical"






- The sensor housing can be cleaned using a damp cloth. Do NOT immerse the sensor in any cleaning media.
- At ambient conditions. All performance measurements are at STP unless otherwise stated. Following extreme temperature fluctuations, re-calibration may be required.




OUTLINE DRAWING

All dimensions shown in mm. Tolerances = ± 0.5 mm.

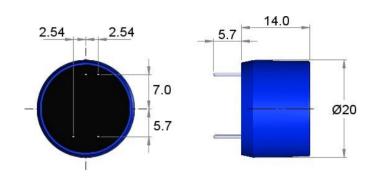

ELECTRICAL INTERFACE

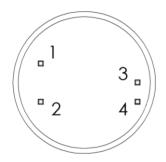

Pin	Designation
1	Vs (+5V)
2	GND (0V)
3	3.3V USART Sensor Transmit
4	3.3V USART Sensor Receive

CONNECTION: Four gold-plated pins (0.64mm²) on a 2.54mm grid for PCB mounting via sockets or hand soldering using no-clean flux.


NOTE: Do NOT put the sensor through a PCB washing process.

NOTE: Always apply power to sensor pins 1 and 2 before attempting to communicate on pins 3 and 4.



The sensor should be treated as an electronic component and handled using the correct ESD handling precautions.



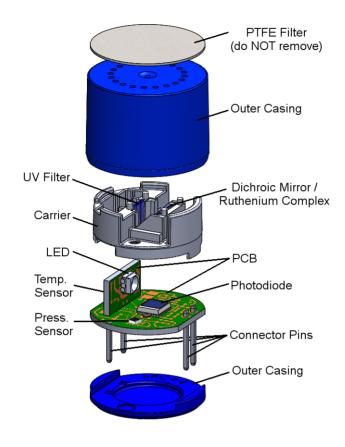

ORDER INFORMATION

Specify the part number below when ordering:

L O X - 0 2 - S

Do not exceed maximum ratings and ensure sensor(s) are operated in accordance with their requirements.

Carefully follow all wiring instructions. Incorrect wiring can cause permanent damage to the device.

Do NOT use chemical cleaning agents.

Failure to comply with these instructions may result in product damage.

These products must not be used in safety applications where product failure could cause injury or risk to life

INFORMATION

As customer applications are outside of SST Sensing Ltd.'s control, the information provided is given without legal responsibility. Customers should test under their own conditions to ensure that the equipment is suitable for their intended application.

For technical assistance or advice, please email: technical@sstsensing.com

General Note: SST Sensing Ltd. reserves the right to make changes to product specifications without notice or liability. All information is subject to SST Sensing Ltd.'s own data and considered accurate at time of going to print.



