


CO-B1 Carbon Monoxide Sensor

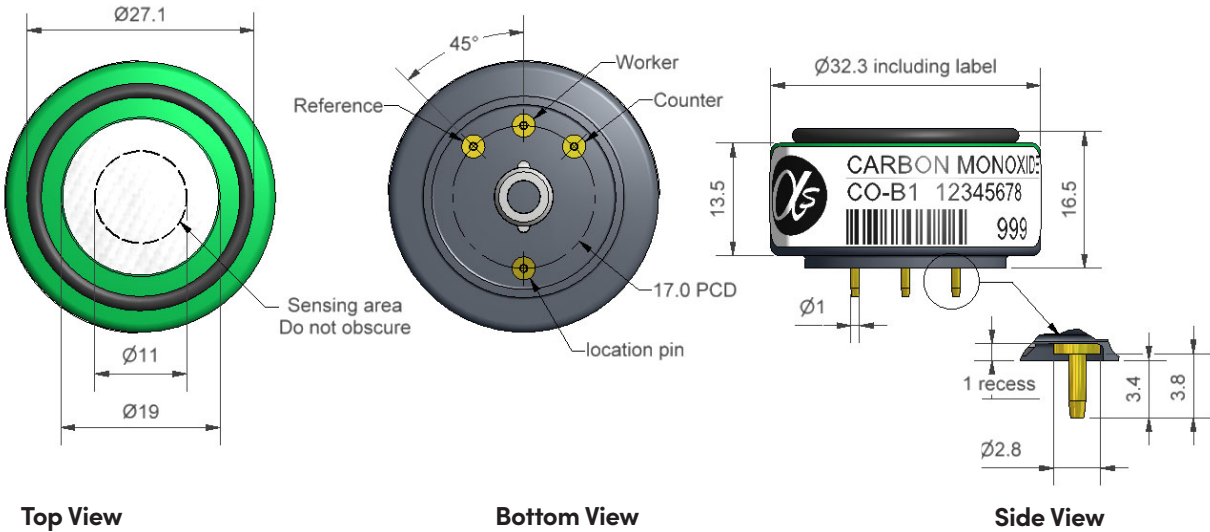

Dimensions are in millimetres (± 0.1 mm).

Performance	Sensitivity	nA/ppm in 400ppm CO		80 to 130
	Response time	t90 (s) from zero to 400ppm CO		< 25
	Zero current	ppm equivalent in zero air		< ± 4
	Resolution	RMS noise (ppm equivalent)		< 0.5
	Range	ppm limit of performance warranty		5,000
	Linearity	ppm CO error at full scale, linear at zero, 1000ppm CO		< ± 30
	Overgas limit	maximum ppm for stable response to gas pulse		10,000
Lifetime	Zero drift	ppm equivalent change/year in lab air		< 0.1
	Sensitivity drift	% change/year in lab air, monthly test		< 3
	Operating life	months until 80% original signal (24-month warranted)		> 24
Environmental	Sensitivity @ -20°C	% (output @ -20°C/output @ 20°C) @ 400ppm CO		70 to 88
	Sensitivity @ 50°C	% (output @ 50°C/output @ 20°C) @ 400ppm CO		102 to 115
	Zero @ -20°C	ppm equivalent change from 20°C		< ± 1
	Zero @ 50°C	ppm equivalent change from 20°C		< ± 6
Cross Sensitivity	H ₂ S sensitivity	% measured gas @ 20ppm	H ₂ S	< 200
	NO ₂ sensitivity	% measured gas @ 10ppm	NO ₂	< 50
	Cl ₂ sensitivity	% measured gas @ 10ppm	Cl ₂	< -1
	NO sensitivity	% measured gas @ 50ppm	NO	< 80
	SO ₂ sensitivity	% measured gas @ 20ppm	SO ₂	< 50
	H ₂ sensitivity	% measured gas @ 400ppm	H ₂ at 20°C	< 65
	C ₂ H ₄ sensitivity	% measured gas @ 400ppm	C ₂ H ₄	< 65
	NH ₃ sensitivity	% measured gas @ 20ppm	NH ₃	< 0.1
Key Specifications	Temperature range	°C		-30 to 50
	Pressure range	kPa		80 to 120
	Humidity range	% rh continuous		15 to 90
	Storage period	months @ 3 to 20°C (stored in sealed pot)		6
	Load resistor	Ω (recommended)		10 to 47
	Weight	g		< 13



Figure 1 Sensitivity Temperature Dependence

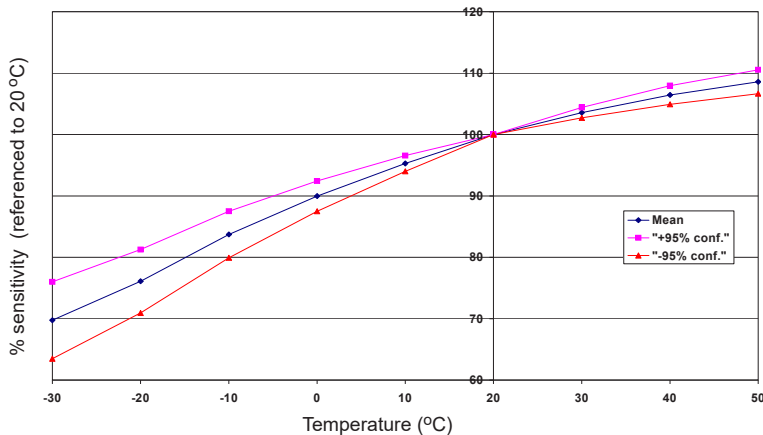


Figure 1 shows the variation in sensitivity caused by changes in temperature.
This data is taken from a typical batch of sensors.

Figure 2 Zero Temperature Dependence


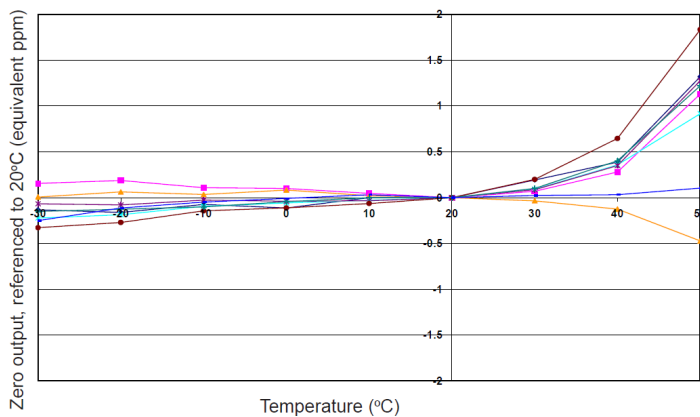


Figure 2 shows the variation in zero output caused by changes in temperature, expressed as ppm gas equivalent, referenced to zero at 20°C.
This data is taken from a typical batch of sensors.

Figure 3 Linearity to 1,000ppm

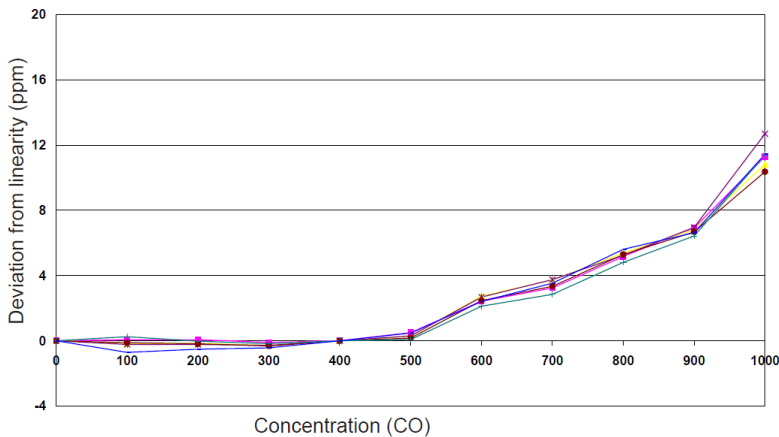

When calibrated at 0 and 400ppm, the sensor shows good linearity with typically 1% non-linearity at 1,000ppm.